
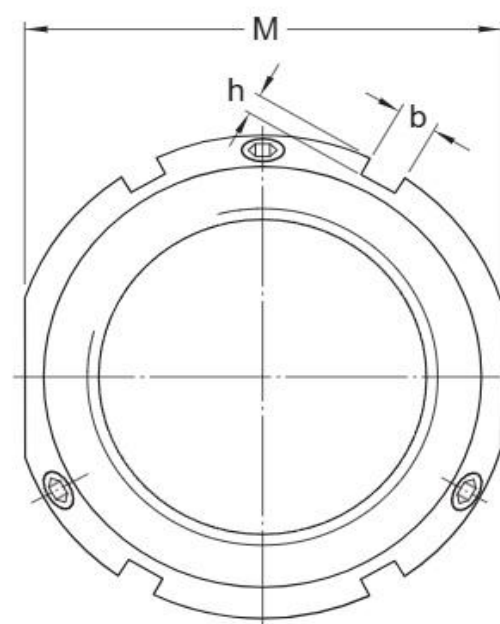


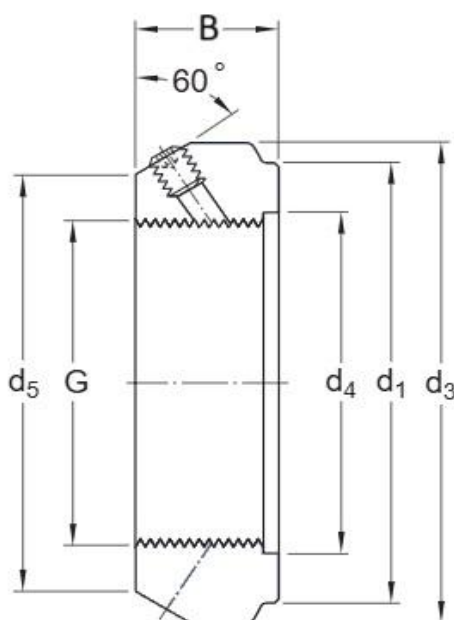

Part No.	Dimensions (mm)									
	d1	B	d3	d4	d5	G-Thread	b	h	M	Set screw size
KMT 0	23	14	28	11	21	M10x0,75	4	2	24	M5
KMT 1	25	14	30	13	23	M12x1	4	2	27	M5
KMT 2	28	16	33	16	26	M15x1	4	2	30	M5
KMT 3	32	18	37	18	29	M17x1	5	2	34	M6
KMT 4	35	18	40	21	32	M20x1	5	2	36	M6
KMT 5	39	20	44	26	36	M25x1,5	5	2	41	M6
KMT 6	44	20	49	32	41	M30x1,5	5	2	46	M6
KMT 7	49	22	54	37	46	M35x1,5	5	2	50	M6
KMT 8	59	22	65	42	54	M40x1,5	6	2,5	60	M8
KMT 9	64	22	70	47	60	M45x1,5	6	2,5	65	M8
KMT 10	68	25	75	52	64	M50x1,5	7	3	70	M8
KMT 11	78	25	85	57	74	M55x2	7	3	80	M8
KMT 12	82	26	90	62	78	M60x2	8	3,5	85	M8
KMT 13	87	28	95	67	83	M65x2	8	3,5	90	M8
KMT 14	92	28	100	72	88	M70x2	8	3,5	95	M8
KMT 15	97	28	105	77	93	M75x2	8	3,5	100	M8
KMT 16	100	32	110	82	98	M80x2	8	3,5	-	M8
KMT 17	110	32	120	87	107	M85x2	10	4	-	M10
KMT 18	115	32	125	92	112	M90x2	10	4	-	M10
KMT 19	120	32	130	97	117	M95x2	10	4	-	M10
KMT 20	125	32	135	102	122	M100x2	10	4	-	M10
KMT 22	134	32	145	112	132	M110x2	10	4	-	M10
KMT 24	144	32	155	122	142	M120x2	10	4	-	M10
KMT 26	154	32	165	132	152	M130x2	12	5	-	M10
KMT 28	164	32	175	142	162	M140x2	14	5	-	M10
KMT 30	174	32	185	152	172	M150x2	14	5	-	M10
KMT 32	184	32	195	162	182	M160x3	14	5	-	M10
KMT 34	192	32	205	172	192	M170x3	14	5	-	M10
KMT 36	204	32	215	182	202	M180x3	16	5	-	M10
KMT 38	214	32	225	192	212	M190x3	16	5	-	M10
KMT 40	224	32	235	202	222	M200x3	18	5	-	M10